

Service News

Audio

YAMAHA CORPORATION

P.O. BOX1, HAMAMATSU, JAPAN

RX-V363, HTR-6130

BULLETIN
NO.

E-1215

DATE June 2008

RELATED

BULLETIN NO.

Firmware Update re: MAIN

SYMPTOM:

1. BGV setting in MULTI CH input can not be hold after power OFF/ON.
2. Pressing other SCENE key during SCENE edit mode won't change input properly.
3. "DOCK" input can be selected in SCENE edit mode in spite of unnecessary select.

CAUSE:

Microprocessor program error

SOLUTION:

Update the microprocessor firmware to the latest version "D017". Download the data from the Yamaha AV Service Information System Web Page/[ROM Update](#).

Version	Checksum	
D017	A.SUM: 4128	P.SUM: 5190
	SPI.S: 02FA	SPD.S: C1A1

SERVICE:

Update the firmware to the latest version, when the failure symptom is reported.