

# Service News

YAMAHA CORPORATION

P.O. BOX1, HAMAMATSU, JAPAN

## Audio

BULLETIN NO. **E-1254**

**RX-V363/HTR-6130**

DATE January 2009

RELATED


BULLETIN NO.

### No Power

**SYMPTOM:** Doesn't power ON. It is likely to occur under low temperature. Can recover by unplugging and then plugging the AC cable back in.

**CAUSE:** Product lot with serial number "Txxxxx8XZ" have been found that some of them won't power on due to CPU error caused by clock line noise from the unevenness of the A/D converter on the DSP board.

**SOLUTION:** By removing C411 chip capacitor from the DSP board, clock line noise will be reduced and prevent CPU error.

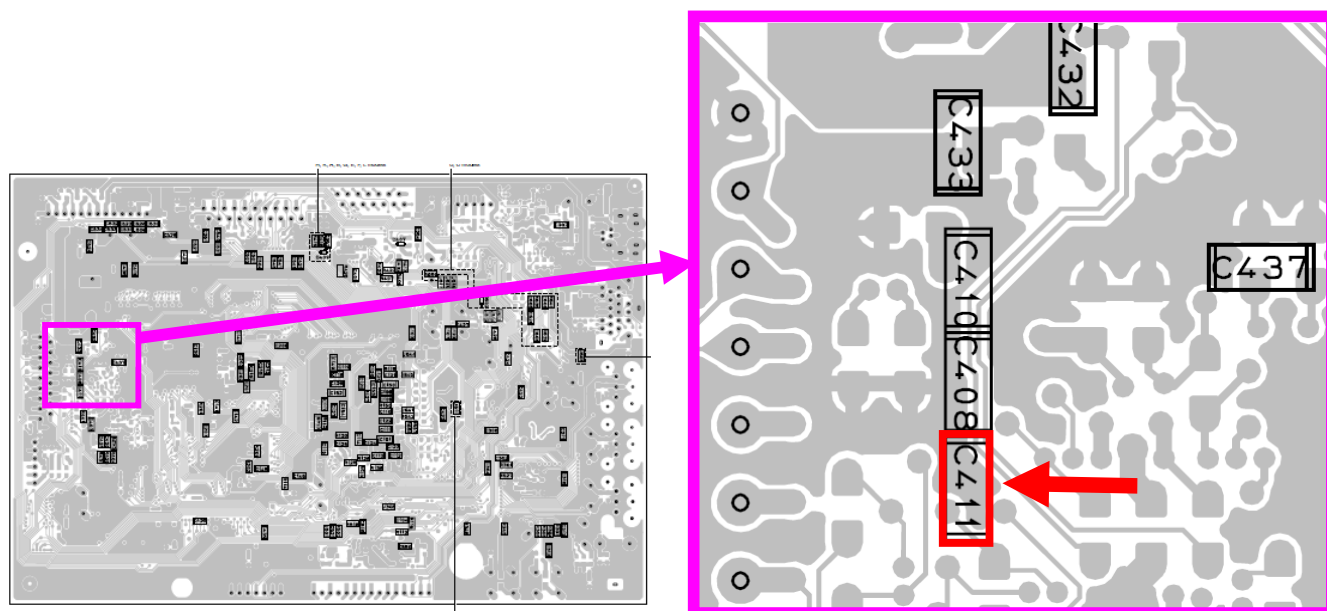

**SERVICING:** Regardless of the symptom, check and remove C411 from all units sent in for service.